

Conservation

| | |
|------------|---|
| Object ID | 4 |
| Heading | Little End Bearings |
| Entry | Both crosshead pins removed and one little end bearing replaced. Timing end piston and rod pulled and inspected, some cracks found in the bridges on the transer ports. Both crosshead slippers packed to reduce "slap" but significant wear present at the mid point of the guide. |
| Entry Date | 2006-02-14 |