

Conservation

Object ID	4,087
Heading	Return To Service
Entry	Big-end rebuilt and fitted. Both main bearings required attention with less than 30% contact on the lower halves and insufficient clearance (1 to 5 thou across the bearing). Bent decompressor shaft repaired
Entry Date	2014-09-11