

Conservation

| | |
|------------|--|
| Object ID | 4,129 |
| Heading | Rebuild |
| Entry | <p>The engine had been fitted with a replacement liner but the work was incomplete. The liner required removal and a missing front seal fitting. Drillings for the quills were required and new quills fabricated.</p> <p>New piston rings were fitted</p> <p>A new pump plunger was fabricated</p> <p>Sideshaft bent probably as a result of improper slinging at some point, now straightened and checked.</p> <p>The big-end was also found to be damaged with distortion in both halves.</p> |
| Entry Date | 2014-03-09 |